



# **INSPECTION REPORT**

Inspector: Paulo Narduche

License # 3380001301

10000 Sample Street, Sample, VA 10000 Inspection prepared for: Sample Client Real Estate Agent: Sample Agent

Date of Inspection: 12/21/2021 Time: 9:00 AM Year Built: 1963 Size (sqft): 2400 Weather: Cloudy 30 to 35 degrees F Order ID: 9504








46179 Westlake Dr, Suite 200B, Sterling Va 20165








#### **Table Of Contents**

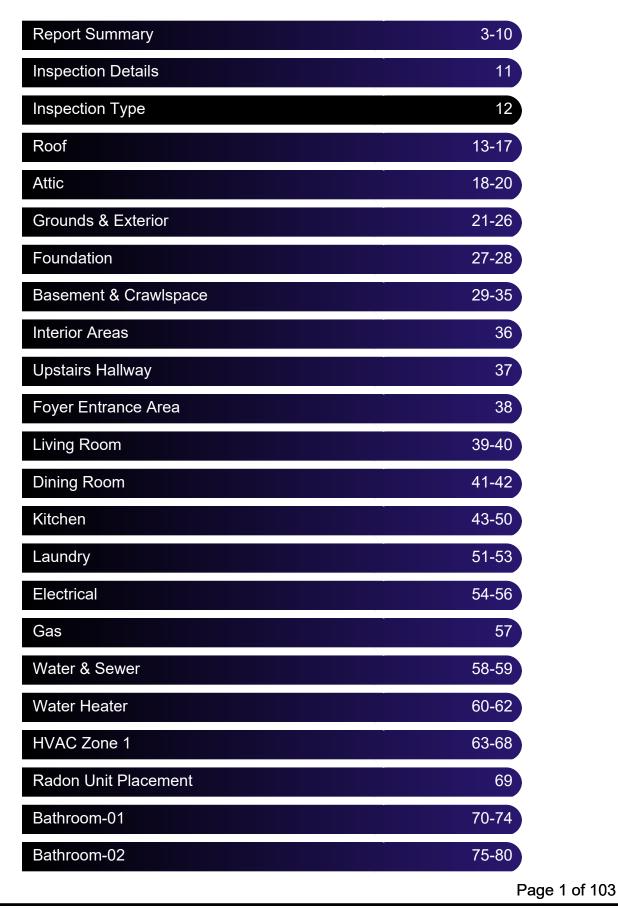

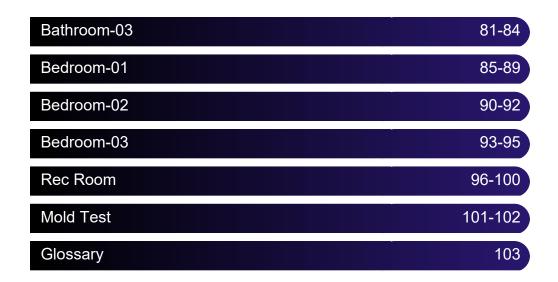

#### Report Summary

The summary below consists of potentially significant findings. These findings can be a safety hazard, a deficiency requiring a major expense to correct or items I would like to draw extra attention to. The summary is not a complete listing of all the findings in the report, and reflects the opinion of the inspector. Please review all pages of the report as the summary alone does not explain all of the issues. All repairs should be done by a licensed & bonded tradesman or qualified professional. I recommend obtaining a copy of all receipts, warranties and permits for the work done.

Monitor		
Roof	-	
Page 13 Item: 1	Roof Condition	<ul> <li>Roof appears to be in functional shape with normal wear for its age. Shingle are possibly near the end of its useful life.</li> <li>Moss or organic growth on roof. This can lead to the premature failure of the roof and subsequent leaks. Recommend treating moss during its growing season (wet months) with a moss killer. For information on various moss treatment products and their pros and cons, visit http://bryophytes.science.oregonstate.edu/page24.htm.</li> </ul>
<b>Grounds &amp; Exter</b>	ior	
Page 25 Item: 8	Cladding Condition	• Monitor: Maintain all exterior finishes, caulking, and other sealants at any dissimilar material abutments and all penetrations to the walls and roof. This inexpensive task aids in the prevention of moisture intrusion and saves on costly repairs.
Basement & Crav	wlspace	
Page 30 Item: 2	Access	• MONITOR; Keep all exterior drains free of leafs and debris, clog drains can potentially lead to water intrusion.
Water & Sewer		
Page 58 Item: 1	Water Main	• Corrosion noted around valve, no leaks noted at the time of the inspection, monitor the area for worsening condition.
Bathroom-01		
Page 73 Item: 11	Shower Walls	• Monitor: Keep all components properly grouted, caulked or otherwise appropriately sealed to prevent water infiltration.
Bathroom-02		
Page 77 Item: 9	Plumbing	<ul> <li>Stains noted under the sink, tested dry at the time of the inspection, monitor the areas for possible water leaks.</li> <li>Older style metal traps noted. Buyer is cautioned that these traps can leak at any time due to corrosion.</li> </ul>
Bathroom-03		
Page 83 Item: 10	Plumbing	• Older style metal traps noted. Buyer is cautioned that these traps can leak at any time due to corrosion.
Bedroom-01		
Page 87 Item: 6	Window Condition	• Stains noted around window frame, areas tested dry at the time of the inspection, monitor the areas for possible water intrusion.

Ν	ext	Day	Insp	ect

Bedroom-03	-	
Page 93 Item: 3	Ceiling Condition	• Small stains noted on the ceiling. They tested dry at the time of the inspection.
Maintenance		
Roof		
Page 14 Item: 2	Gutter	Clean gutters: Debris evident.
Page 17 Item: 5	Furnace Flue	• Chimney rain cap is rusted, suggest painting to preserve its remaining life.
Grounds & Exte	rior	
Page 22 Item: 3	Vegetation Observations	• Maintenance Tip: When landscaping, keep plants, even at full growth, at least a foot (preferably 18 inches) from house siding and windows. Keep trees away from foundation and roof. Plants in contact or proximity to home can provide pathways for wood destroying insects, as well as abrade and damage siding, screens and roofs.
Page 24 Item: 7	Exterior Faucet Condition	<ul> <li>Recommend upgrading to a frost proof type hose bib to prevent possible damage due to cracking of water line in below freezing temperatures.</li> </ul>
HVAC Zone 1		
Page 63 Item: 1	AC Compress Condition	• Maintenance Tip: Recommend that HVAC professional seasonally check the air conditioning unit, and ensure the unit is level. This can be accomplished at the same time as the annual furnace inspection.
Page 64 Item: 4	Heater Condition	• Recommend the unit to be serviced seasonally by a qualified HVAC specialist.
Page 65 Item: 5	Filters	The filter is dirty. Needs replacement.

Repair		
Roof	_	
Page 13 Item: 1	Roof Condition	• Clean roof areas: Significant amounts of organic debris evident.
Page 14 Item: 2	Gutter	• Extensions/splash blocks missing or insufficient at one or more downspouts. Recommend installing a 6-feet extension to divert water away from the foundation.
Page 16 Item: 4	Chimney	• Chimney Cap with mortar deterioration and cracks noted, potential moisture intrusion. Recommend having a licensed qualified professional evaluate and correct as necessary.
Attic		
Page 20 Item: 4	Ventilation	• Recommend adding additional ventilation to avoid premature aging of roof and help to maintain proper humidity and temperature control.

Grounds & Exter	ior		
Page 21 Item: 1	Driveway and Walkway Condition	<ul> <li>Typical cracking was observed at the concrete surfaces.</li> <li>Further deterioration will occur as water expands and contracts from freeze and thaw cycles. Recommend sealing the cracks to prolong the life of the concrete.</li> </ul>	
Page 22 Item: 4	Gate Condition	<ul> <li>Further deterioration will occur as water expands and contracts from freeze and thaw cycles. Recommend sealing the cracks to prolong the life of the concrete.</li> <li>Gate doesn't close, locking hardware is missing/not operable. Repair/replace as needed.</li> <li>Gaps around exterior wall penetration. Recommend sealing/caulking all gaps to prevent water penetration to t wall structure. (back faucet)</li> <li>Minor settlement, or "hairline" crack(s) in break walls, ar normal for properties of any age. They should, however, the monitored for expansion and sealed as necessary.</li> <li>High Moisture was observed in numerous areas of the foundation. Moisture can create high humidity, mold &amp; can damage stored items &amp; finishing materials. It is recomment to have a basement specialist review the foundation for correcting the moisture intrusion and advise as needed be closing.</li> <li>Lower level storm door hardware damage/inoperable, repair/replace as needed.</li> <li>Some cracks observed(common), suggest sealing crack necessary.</li> </ul>	
Page 24 Item: 7	Exterior Faucet Condition	sealing/caulking all gaps to prevent water penetration to the	
Page 25 Item: 8	Cladding Condition	<ul> <li>Minor settlement, or "hairline" crack(s) in break walls, are normal for properties of any age. They should, however, be monitored for expansion and sealed as necessary.</li> </ul>	
Foundation			
Page 27 Item: 1	Foundation Walls	foundation. Moisture can create high humidity, mold & can damage stored items & finishing materials. It is recommended to have a basement specialist review the foundation for correcting the moisture intrusion and advise as needed before	
Basement & Crav	wlspace		
Page 30 Item: 2	Access		
Page 31 Item: 5	Slab Floor	<ul> <li>Some cracks observed(common), suggest sealing cracks as necessary.</li> </ul>	
Page 32 Item: 6	Insulation	<ul> <li>Recommend adding insulation to perimeter of structure to enhance the homes heating efficiency.</li> </ul>	
Page 33 Item: 8	Framing	<ul> <li>Stains and wood deterioration noted, recommend consulting with a qualified contractor for further evaluation and repair options.</li> </ul>	
Living Room			
Page 39 Item: 4	Floor Condition	<ul> <li>Stains observed on the carpet. Recommend clean/replace as needed.</li> </ul>	
Page 40 Item: 6	Electrical	<ul> <li>The home contained outdated, ungrounded 2-prong electrical outlets. Consider updating the existing condition to meet current standards.</li> </ul>	
Dining Room			
Page 41 Item: 5	Electrical	<ul> <li>The home contained outdated, ungrounded 2-prong electrical outlets. Consider updating the existing condition to meet current standards.</li> </ul>	
Page 42 Item: 7	Patio Doors	<ul> <li>The patio door did not lock at the time of the inspection, repair/replace hardware as needed.</li> </ul>	
Kitchen			
Page 44 Item: 7	Cabinets	<ul> <li>Damaged /rotted wood noted under the kitchen sink, repair/replace as needed.</li> <li>Loose cabinet door handle noted, repair as needed.</li> </ul>	
Page 46 Item: 10	Sinks	<ul> <li>Sink faucet is loose, suggest securing as necessary.</li> </ul>	

Laundry		
Page 52 Item: 7	Wash Basin	<ul> <li>Drain line leaks under sink. Repair//replace as needed.</li> <li>The laundry faucet leaks. Repair/replace as needed.</li> </ul>
Electrical		
Page 54 Item: 1	Electrical Panel	<ul> <li>Panel cover screw(s) missing. Recommend installing the missing screws.</li> </ul>
Page 55 Item: 5	Breakers	• White wire connected to hot breaker switch, white wires are designated to neutral bus connection, replace or label as needed.
Bathroom-01	-	
Page 70 Item: 3	Doors	• Door stopper was missing. Recommend installation to avoid unnecessary wall or door damage.
Page 71 Item: 5	Walls Condition	• Minor cracks noted, recommend repair/seal as needed.
Page 71 Item: 8	Sinks	<ul> <li>Inoperable stopper noted. Recommend repair/replace as needed.</li> <li>Sink is loose, recommend repair/secure as needed.</li> </ul>
Page 73 Item: 13	Toilets	• Not operated due to active leak noted on the door by the Homeowner, Recommend consulting with a qualified plumber for further evaluation and repair options.
Bathroom-02		
Page 75 Item: 4	Floor Condition	<ul> <li>Gaps noted between floor and tub, recommend sealing all gaps to prevent possible water filtration to the sub floor.</li> </ul>
Page 76 Item: 5	Walls Condition	• Loose baseboards noted, repair/secure as needed.
Page 76 Item: 8	Sinks	<ul> <li>Inoperable stopper noted. Recommend repair/replace as needed.</li> <li>Damaged faucet handle noted, repair/replace as needed.</li> </ul>
Page 78 Item: 11	Shower Walls	<ul> <li>Caulk deterioration observed, repair/ re caulk as needed.</li> </ul>
Bathroom-03		
Page 81 Item: 3	Doors	• Door stopper was missing. Recommend installation to avoid unnecessary wall or door damage.
Page 82 Item: 7	Exhaust Fan	• Missing fan cover noted at the time of the inspection Repair as needed.
Page 82 Item: 8	Electrical	• Open ground (or 2-wire) outlets present. This means that the 3rd (round) part of an appliance plug is not getting ground protection. This may be a concern with items such as computers and electronic devices.
Page 83 Item: 9	Sinks	<ul> <li>Inoperable stopper noted. Recommend repair/replace as needed.</li> </ul>
Page 83 Item: 11	Toilets	• Toilet did not flush at the time of the inspection, loose handle noted. Repair as needed.
Page 84 Item: 12	Heating	Missing register cover noted. Repair as needed.
Bedroom-01		
Page 85 Item: 2	Doors	• Bedroom door didn't latch when tested. Recommend repair as needed.

Page 85 Item: 4	Wall Condition	• Large stains noted on the walls. They tested dry at the time of the inspection. Recommend consulting with the appropriate contractor for further evaluation and repair /replace the damaged areas as needed.
Page 86 Item: 5	Floor Condition	• Stains observed on the carpet. Recommend clean/replace as needed.
Page 88 Item: 7	Electrical	• The home contained outdated, ungrounded 2-prong electrical outlets. Consider updating the existing condition to meet current standards.
Page 89 Item: 8	Ceiling Fans	<ul> <li>Ceiling fan light fixture missing or not working light bulbs, repair as needed</li> </ul>
Bedroom-02		
Page 90 Item: 2	Doors	• Door stopper is missing/broken. Recommend installation of door stoppers to prevent damage to walls and other doors.
Page 91 Item: 4	Wall Condition	• Large stains noted on the walls. They tested dry at the time of the inspection. Recommend consulting with the appropriate contractor for further evaluation and repair /replace the damaged areas as needed.
Page 91 Item: 5	Floor Condition	• Stains observed on the carpet. Recommend clean/replace as needed.
Page 92 Item: 7	Electrical	• The home contained outdated, ungrounded 2-prong electrical outlets. Consider updating the existing condition to meet current standards.
Bedroom-03		
Page 93 Item: 2	Doors	• Bedroom door didn't latch when tested. Recommend repair as needed.
Page 94 Item: 5	Floor Condition	• Stains observed on the carpet. Recommend clean/replace as needed.
Rec Room		
Page 97 Item: 6	Fireplace	<ul> <li>Crack in fireplace box noted. Crack less than 1/16 of an inch wide or if you can not fit a dime into the crack, that it may be OK or that just a limited repair would be wise.</li> <li>The flue is dirty, creosote buildup noted, recommend clean and sweep the chimney by a certified professional.</li> <li>Loose bricks and mortar deterioration noted, repair/replace as needed.</li> </ul>
Page 99 Item: 8	Electrical	• Light fixtures or bulbs inoperable. Change bulb and check.

Safety		
Attic		
Page 18 Item: 2	Structure	• Possible organic substance noted. The United States Environmental Protection Association (EPA) states, "If you believe that you may have a hidden mold problem, consider hiring a professional." (Brief Guide to Mold, p.14, EPA). If any area of the residence is suspected of having organic growth, or any member of your family or household is sensitive to mold, we are lab-certified to conduct a Mold Inspection / Sampling to identify the types of mold (or any other airborne allergens) present.
Grounds & Exter	ior	
Page 26 Item: 9	GFCI	• Outdoor receptacles are not GFCI protected. Recommend updating to GFCI by a licensed electrician.
Basement & Crav	wlspace	
Page 32 Item: 7	Electrical condition	• Noted multiple receptacles and switches boxes hanging loose. Re-attache and secure all receptacle and switches boxes in its place for safety.
Page 33 Item: 8	Framing	• Mold like spores present, recommend further investigation by means of testing the indoor air quality for elevated mold spore counts
Page 35 Item: 10	Smoke Detector Condition	• SAFETY CONCERN: There are no visible smoke detectors on the lower level. You need to be alarmed in case of a fire. Recommend installing at least one smoke detector on each level of the home.
Interior Areas		
Page 36 Item: 1	Stairs & Handrail	<ul> <li>Loose or wobbly guardrail and handrail observed.</li> <li>Recommend repair/secure as needed.</li> <li>Missing handrails for stairs to the lower level, recommend installation for safety.</li> </ul>
Upstairs Hallway	1	
Page 37 Item: 1	Smoke Detectors	• SAFETY CONCERN: The smoke alarm(s) did not operate when tested. You need to be alerted in case of a fire. Recommend repair or replacement of the smoke alarm.
Kitchen		
Page 44 Item: 6	GFCI	• No GFCI protection present. Recommend installing GFCI protected receptacles for safety.
Laundry		
Page 52 Item: 6	GFCI	• The laundry receptacle should be GFCI protected type. Recommend upgrade as needed.
Bedroom-01		
Page 89 Item: 9	Smoke Detectors	• There were no smoke detectors present in the bedroom(s).
Page 89 Item: 10	Closets	• Mold like spores present, recommend further investigation by means of testing the indoor air quality for elevated mold spore counts.
Bedroom-02		
Page 92 Item: 8	Smoke Detectors	• There were no smoke detectors present in the bedroom(s).

Page 8 of 103

Bedroom-03	-	
Page 95 Item: 9	Smoke Detectors	• There were no smoke detectors present in the bedroom(s).
Rec Room	-	
Page 99 Item: 9		• SAFETY CONCERN: The smoke alarm(s) did not operate when tested. You need to be alerted in case of a fire. Recommend repair or replacement of the smoke alarm.

#### **INTRODUCTION:**

We appreciate the opportunity to conduct this inspection for you! Please carefully read your entire Inspection Report. Call us after you have reviewed your report, so we can go over any questions you may have. Remember, when the inspection is completed and the report is delivered, we are still available to you for any questions you may have, throughout the entire closing process.

Properties being inspected do not "Pass" or "Fail." - The following report is based on an inspection of the visible portion of the structure; inspection may be limited by vegetation and possessions. Depending upon the age of the property, some items like GFCI outlets may not be installed; this report will focus on safety and function, not current code. This report identifies specific non-code, non-cosmetic concerns that the inspector feels may need further investigation or repair.

For your safety and liability purposes, we recommend that licensed contractors evaluate and repair any critical concerns and defects. Note that this report is a snapshot in time. We recommend that you or your representative carry out a final walk-through inspection immediately before closing to check the condition of the property, using this report as a guide.

## **Inspection Details**

#### 1. Attendance

#### In Attendance: Client present • Buyer Agent present

#### 2. Home Type

Home Type: Detached • Single Family Home

#### 3. Occupancy

Occupancy: Occupied - Furnished: Heavy volume of personal and household items observed. • The utilities were on at the time of inspection. • ACCESS TO SOME ITEMS SUCH AS: ELECTRICAL OUTLETS, WINDOWS, WALL/FLOOR SURFACES, AND CABINET INTERIORS WAS RESTRICTED BY FURNITURE AND LARGE QUANTITY OF PERSONAL BELONGINGS. ANY SUCH ITEMS ARE EXCLUDED FROM THIS INSPECTION REPORT.

ext Day Inspect					
		Inspec	ction Ty	ype	
<b>1. Limitations</b> Good Fair Poor N/A					
	Materials:	Residential H	ome Inspectio	on	
· · ·					

Roof Condition		
	<ul> <li>are possibly near the end of its</li> <li>Moss or organic growth on ro the roof and subsequent leaks.</li> <li>season (wet months) with a month treatment products and their pr</li></ul>	nal shape with normal wear for its age. Shing useful life. of. This can lead to the premature failure of . Recommend treating moss during its growi oss killer. For information on various moss

Good

1



• Extensions/splash blocks missing or insufficient at one or more downspouts. Recommend installing a 6-feet extension to divert water away from the foundation.

• Clean gutters: Debris evident.



Page 15 of 103



#### 4. Chimney

Good	Fair	Poor	N/A	None	_
	1				

Observations: • Chimney Cap with mortar deterioration and cracks noted, potential moisture intrusion. Recommend having a licensed qualified professional evaluate and correct as necessary.





5. Furnace Flue
Good Fair Poor N/A None Observations: • Chimney rain cap is rusted, suggest painting to preserve its remaining life.



Good	Fair	Poor	N/A	None	
					•
					_ I

Observations: Possible organic substance noted. The United States Environmental Protection Association (EPA) states, "If you believe that you may have a hidden mold problem, consider hiring a professional." (Brief Guide to Mold, p.14, EPA). If any area of the residence is suspected of having organic growth, or any member of your family or household is sensitive to mold, we are lab-certified to conduct a Mold Inspection / Sampling to identify the types









#### 3. Insulation Condition



Materials: Blown in cellulose insulation noted. Depth: Insulation averages about 6-8 inches in depth Observations:

• Insulation appeared adequate and in good condition.







Next Day Inspect
4. Ventilation
Image: Poor indicating the poor ind
5. Attic Plumbing
<ul> <li>Good Fair Poor N/A None</li> <li>Observations:</li> <li>Image: No deficiencies noted in plumbing vent piping at the time of the inspection.</li> </ul>
6. Chimney
Good Fair Poor N/A None Observations: ✓ Double wall metal B-Vent pipe noted.

	Crow	de 9 Exterior	
1. Driveway and Wal		nds & Exterior	
Good Fair Poor N/A None	Materials: Concrete wal		dewalk crete surfaces. Further nd contracts from freeze and thaw prolong the life of the concrete.



## 2. Grading

Geod       Feir       For       NA       Nome         ↓       ↓       Lot grading and drainage have a significant impact on the building, simply because of the direct and indirect damage that moisture can have on the foundation. It is very important that surface runoff water be adequately diverted away from the home. Lot grading should slope away and fall a minimum of six (6) inches within the first ten (10) feet around the perimeter of the building.         •       •       No major system safety or function concerns noted at the time of inspection.         3. Vegetation Observations:       •       No major system safety or functional concerns noted at the time of inspection.         •       •       No major system safety or functional concerns noted at the time of inspection.         •       •       •       No major system safety or functional concerns noted at the time of inspection.         •       •       •       •       No major system safety or functional concerns noted at the time of inspection.         •       •       •       •       •       •         •       •       •       •       •       •         •       •       •       •       •       •       •         •       •       •       •       •       •       •       •         •       •       •       •       •       • <t< th=""><th><ul> <li>✓ Observations:         <ul> <li>Lot grading and drainage have a significant impact on the building, simply because of the direct and indirect damage that moisture can have on the foundation. It is very important that surface runoff water be adequately diverted away from the home. Lot grading should slope away and fall a minimum of six (6) inches within the first ten (10) feet around the perimeter of the building.</li> <li>No major system safety or function concerns noted at the time of inspection.</li> </ul> </li> <li>3. Vegetation Observations         <ul> <li>✓ Male</li> <li>✓ Maintenance Tip: When landscaping, keep plants, even at full growth, at least a foot (preferably 18 inches) from house siding and windows. Keep trees away from foundation and roof. Plants in contact or proximity to home can provide pathways for wood destroying insects, as well as abrade and damage siding, screens and roofs.</li> </ul> </li> <li>4. Gate Condition         <ul> <li>Good Fair Poor NVA Nore</li> <li>Materials: Wood Observations:             <ul> <li>✓ Materials: Wood Observations:</li> <li>✓ Gate doesn't close, locking hardware is missing/not operable.</li> </ul> </li> </ul></li></ul></th><th>2. Gradi</th><th>ing</th><th></th><th></th><th></th></t<>	<ul> <li>✓ Observations:         <ul> <li>Lot grading and drainage have a significant impact on the building, simply because of the direct and indirect damage that moisture can have on the foundation. It is very important that surface runoff water be adequately diverted away from the home. Lot grading should slope away and fall a minimum of six (6) inches within the first ten (10) feet around the perimeter of the building.</li> <li>No major system safety or function concerns noted at the time of inspection.</li> </ul> </li> <li>3. Vegetation Observations         <ul> <li>✓ Male</li> <li>✓ Maintenance Tip: When landscaping, keep plants, even at full growth, at least a foot (preferably 18 inches) from house siding and windows. Keep trees away from foundation and roof. Plants in contact or proximity to home can provide pathways for wood destroying insects, as well as abrade and damage siding, screens and roofs.</li> </ul> </li> <li>4. Gate Condition         <ul> <li>Good Fair Poor NVA Nore</li> <li>Materials: Wood Observations:             <ul> <li>✓ Materials: Wood Observations:</li> <li>✓ Gate doesn't close, locking hardware is missing/not operable.</li> </ul> </li> </ul></li></ul>	2. Gradi	ing			
<ul> <li>Good Fair Poor N/A None</li> <li>Observations:</li> <li>No major system safety or functional concerns noted at the time of inspection.</li> <li>Maintenance Tip: When landscaping, keep plants, even at full growth, at least a foot (preferably 18 inches) from house siding and windows. Keep trees away from foundation and roof. Plants in contact or proximity to home can provide pathways for wood destroying insects, as well as abrade and damage siding, screens and roofs.</li> </ul> 4. Gate Condition           Good Fair Poor N/A None         Materials: Wood           Observations:         • Gate doesn't close, locking hardware is missing/not operable.	<ul> <li>Good Fair Poor NA None</li> <li>Observations:</li> <li>• No major system safety or functional concerns noted at the time of inspection.</li> <li>• Maintenance Tip: When landscaping, keep plants, even at full growth, at least a foot (preferably 18 inches) from house siding and windows. Keep trees away from foundation and roof. Plants in contact or proximity to home can provide pathways for wood destroying insects, as well as abrade and damage siding, screens and roofs.</li> </ul> <b>4. Gate Condition</b> Good Fair Poor NA None         Materials: Wood Observations:           • Gate doesn't close, locking hardware is missing/not operable.		Poor	N/A	None	<ul> <li>Lot grading and drainage have a significant impact on the building, simply because of the direct and indirect damage that moisture can have on the foundation. It is very important that surface runoff water be adequately diverted away from the home. Lot grading should slope away and fall a minimum of six (6) inches within the first ten (10) feet around the perimeter of the building.</li> <li>No major system safety or function concerns noted at the time of</li> </ul>
<ul> <li>Observations:</li> <li>No major system safety or functional concerns noted at the time of inspection.</li> <li>Maintenance Tip: When landscaping, keep plants, even at full growth, at least a foot (preferably 18 inches) from house siding and windows. Keep trees away from foundation and roof. Plants in contact or proximity to home can provide pathways for wood destroying insects, as well as abrade and damage siding, screens and roofs.</li> <li><b>4. Gate Condition</b></li> <li>Materials: Wood Observations:</li> <li>Gate doesn't close, locking hardware is missing/not operable.</li> </ul>	<ul> <li>✓ Observations:         <ul> <li>No major system safety or functional concerns noted at the time of inspection.</li> <li>Maintenance Tip: When landscaping, keep plants, even at full growth, at least a foot (preferably 18 inches) from house siding and windows. Keep trees away from foundation and roof. Plants in contact or proximity to home can provide pathways for wood destroying insects, as well as abrade and damage siding, screens and roofs.</li> </ul> </li> <li>4. Gate Condition         <ul> <li>Good Fair Poor MA None</li> <li>Materials: Wood Observations:             <ul> <li>Gate doesn't close, locking hardware is missing/not operable.</li> </ul> </li> </ul></li></ul>	3. Vege	tatio	n Ot	oserv	vations
Good Fair Poor N/A None ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓	Good Fair Poor N/A None ✓ Observations: • Gate doesn't close, locking hardware is missing/not operable.		Poor	N/A	None	<ul> <li>No major system safety or functional concerns noted at the time of inspection.</li> <li>Maintenance Tip: When landscaping, keep plants, even at full growth, at least a foot (preferably 18 inches) from house siding and windows. Keep trees away from foundation and roof. Plants in contact or proximity to home can provide pathways for wood destroying insects, as well as abrade and</li> </ul>
<ul> <li>✓ Materials: Wood</li> <li>Observations:</li> <li>• Gate doesn't close, locking hardware is missing/not operable.</li> </ul>	Materials: Wood Observations: • Gate doesn't close, locking hardware is missing/not operable.	4. Gate	Con	ditio	n	
		Good Fair		N/A	None	Observations: • Gate doesn't close, locking hardware is missing/not operable.



#### 5. Fence Condition



Materials: Wood

Observations: • Appeared serviceable at the time of inspection.



### 6. Patio



Observations: • Appeared in satisfactory and functional condition with normal wear for its age. Appeared to be sound structure.

#### Next Day Inspect



#### 7. Exterior Faucet Condition



Location: Front of the house • Rear of the house Observations:

Appeared functional.
Recommend upgrading to a frost proof type hose bib to prevent possible damage due to cracking of water line in below freezing temperatures.
Gaps around exterior wall penetration. Recommend sealing/caulking all

gaps to prevent water penetration to the wall structure.(back faucet)



Back



Back faucet



#### Front

#### 8. Cladding Condition N/A Fair Poor

Good


None Materials: Brick veneer. • Wood siding.

#### • Wood frame construction. • Concrete blocks foundation. Observations:

• Monitor: Maintain all exterior finishes, caulking, and other sealants at any dissimilar material abutments and all penetrations to the walls and roof. This inexpensive task aids in the prevention of moisture intrusion and saves on costly repairs.

• Minor settlement, or "hairline" crack(s) in break walls, are normal for properties of any age. They should, however, be monitored for expansion and sealed as necessary.



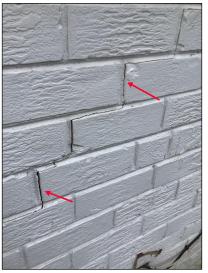



#### Peeling paint

#### 9. GFCI



Observations:

• GFCI protected receptacles may not have been required when the house was built. We suggest buyer consider upgrading with GFCI's at all receptacles near water sources.
Outdoor receptacles are not GFCI protected. Recommend updating to

GFCI by a licensed electrician.



#### 1. Foundation Walls

Good Fair Poor N/A None

Foundation

Observations:

• High Moisture was observed in numerous areas of the foundation. Moisture can create high humidity, mold & can damage stored items & finishing materials. It is recommended to have a basement specialist review the foundation for correcting the moisture intrusion and advise as needed before closing.









High moisture readings



High moisture readings



High moisture readings



High moisture readings

## **Basement & Crawlspace**

#### 1. General Condition




None

Materials: Walk-out Observations: • Appears in serviceable condition.






Page 29 of 103

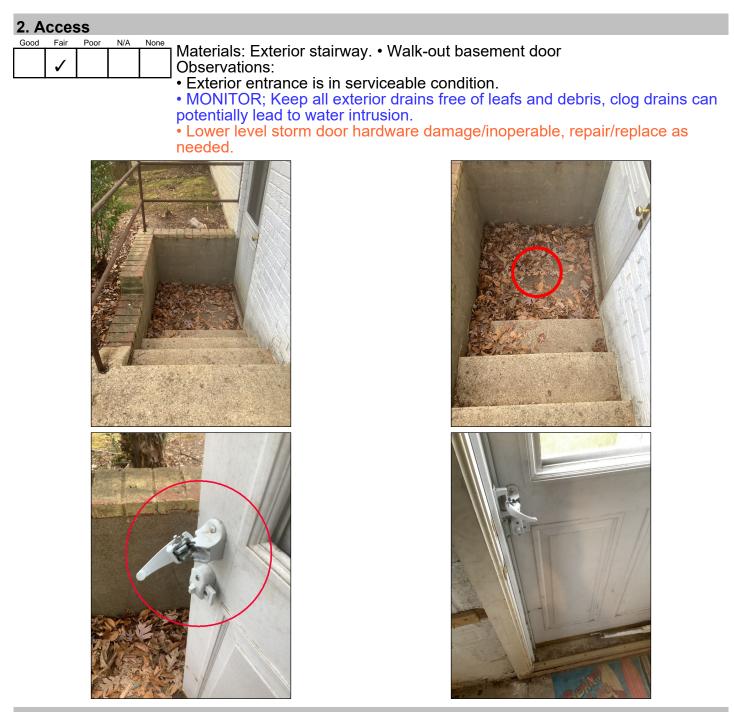


#### 3. Columns

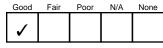

Observations:

• No deficiencies were observed at the visible portions of the structural components of the home.



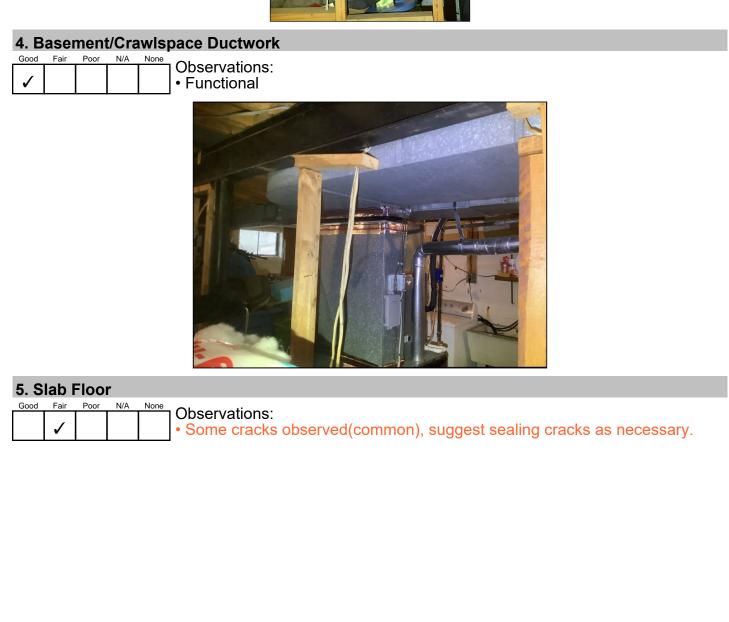

### Next Day Inspect



#### 6. Insulation



Observations: • Recommend adding insulation to perimeter of structure to enhance the homes heating efficiency.

#### 7. Electrical condition


Good	Fair	Poor	N/A	None	
					] IVI8
					l Oł
		•			

aterials: Lights • Outlets bservations:

• Noted multiple receptacles and switches boxes hanging loose. Re-attache and secure all receptacle and switches boxes in its place for safety.





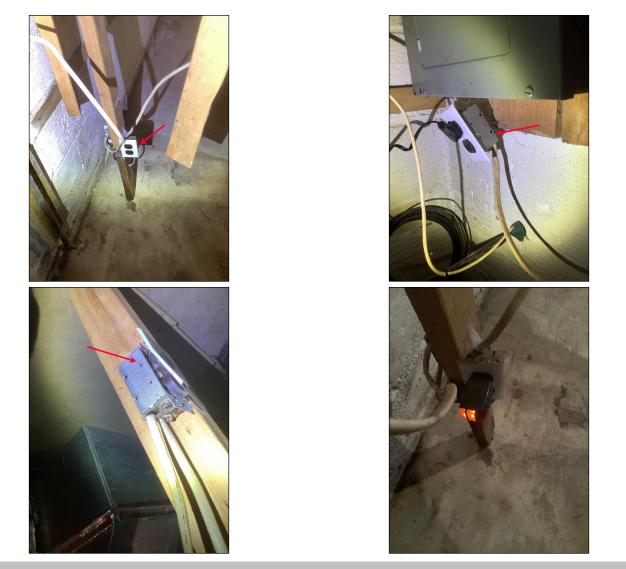

#### 8. Framing



Observations:

Mold like spores present, recommend further investigation by means of testing the indoor air quality for elevated mold spore counts
Stains and wood deterioration noted, recommend consulting with a qualified contractor for further evaluation and repair options.



#### 9. Windows Condition

Good	Fair	Poor	N/A	None
✓				

Materials: Vinyl • Sliding Windows
 Observations:
 • All tested windows were functional at the time of the inspection



10. Smoke Detector Condition
Good Fair Poor N/A None SAFETY CONCERN: There are no visible smoke detectors on the lower level. You need to be alarmed in case of a fire. Recommend installing at least one smoke detector on each level of the home.

### **Interior Areas**

The Interior section covers areas of the house that are not considered part of the Bathrooms, Bedrooms, Kitchen or areas covered elsewhere in the report. Interior areas usually consist of hallways, foyer, and other open areas. Within these areas the inspector is performing a visual inspection and will report visible damage, wear and tear, and moisture problems if seen. Personal items in the structure may prevent the inspector from viewing all areas on the interior.

The inspector does not usually test for mold or other hazardous materials. A qualified expert should be consulted if you would like further testing.

1. Sta	irs &	Hand	Irail
--------	-------	------	-------

Good	Fair	Poor	N/A	None	Observations
					Observations:
		✓			Loose or wobbly guardrail and handrail observed. Recommend
					repair/secure as needed.

• Missing handrails for stairs to the lower level, recommend installation for safety.







**Upstairs Hallway** 

### 1. Smoke Detectors

Good Fair Poor N/A None

Observations:

• Old detectors. Smoke detectors last 6-10 years. Recommend replacing.

Testing of smoke detectors is not included in this inspection. Pushing the "Test" button only verifies that there is power at the detector--either a battery or hard wired to the house power--and not the operational workings of the detector. The operational check is done by filling the sensor with smoke and is beyond the scope of this inspection. Battery operated smoke alarms should be checked routinely and the batteries changed frequently.
SAFETY CONCERN: The smoke alarm(s) did not operate when tested. You need to be alerted in case of a fire. Recommend repair or replacement of the smoke alarm.



## Foyer Entrance Area




1


None

Observations: • All doors and locks appeared functional and operated normally at the time of inspection.



ext Day Inspect
Living Room
1. General View Condition
Good Fair Poor N/A None ✓
2. Ceiling Condition
Good       Fair       Poor       N/A       None         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓       ✓         ✓       ✓       ✓       ✓       ✓
3. Wall Condition
Good       Fair       Poor       N/A       None         ✓
4. Floor Condition
Good Fair Poor N/A None ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓ ✓

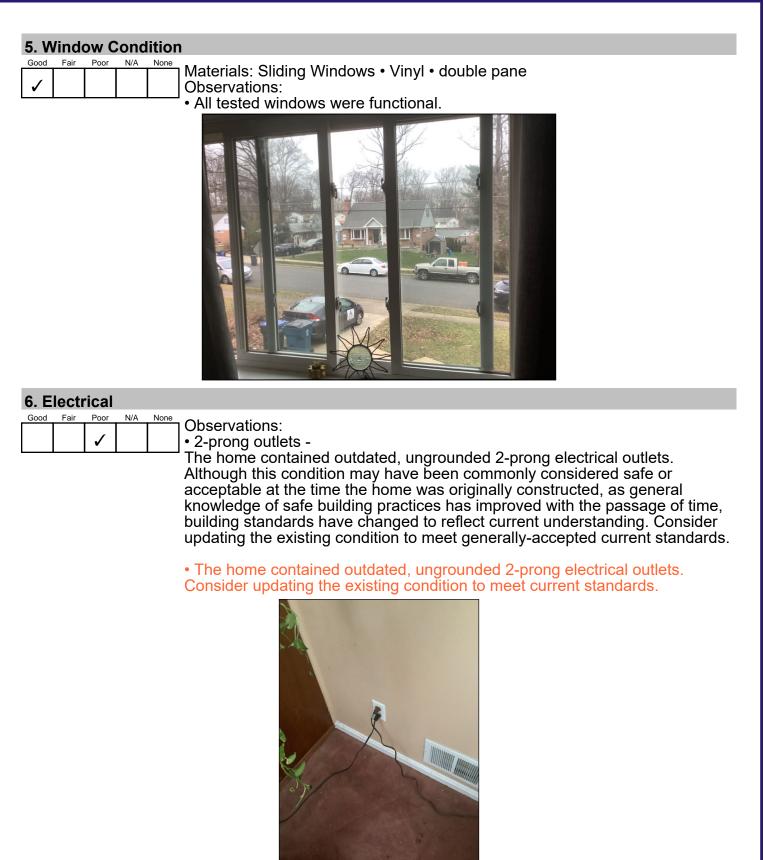

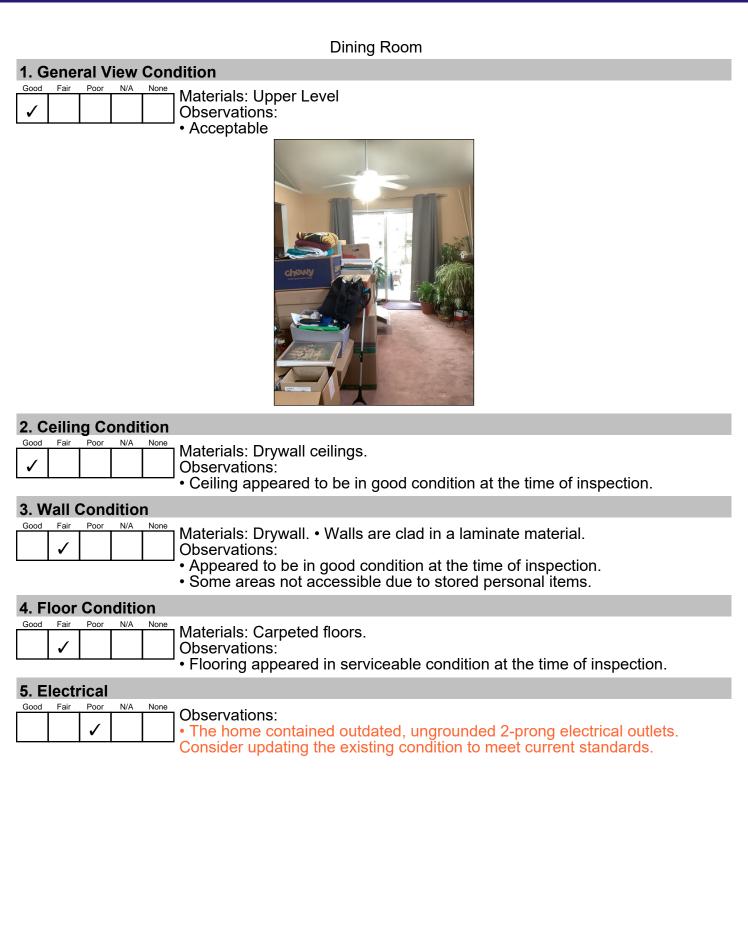



## 6. Ceiling Fans




Observations: • Operated normally when tested at the time of inspection.

## 7. Patio Doors

Good	Fair	Poor	N/A	None
		1		
		•		


Observations: • The patio door did not lock at the time of the inspection, repair/replace hardware as needed.

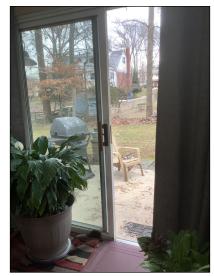



Kitchen

The kitchen is used for food preparation and often for entertainment. Kitchens typically include a stove, dishwasher, sink and other appliances.

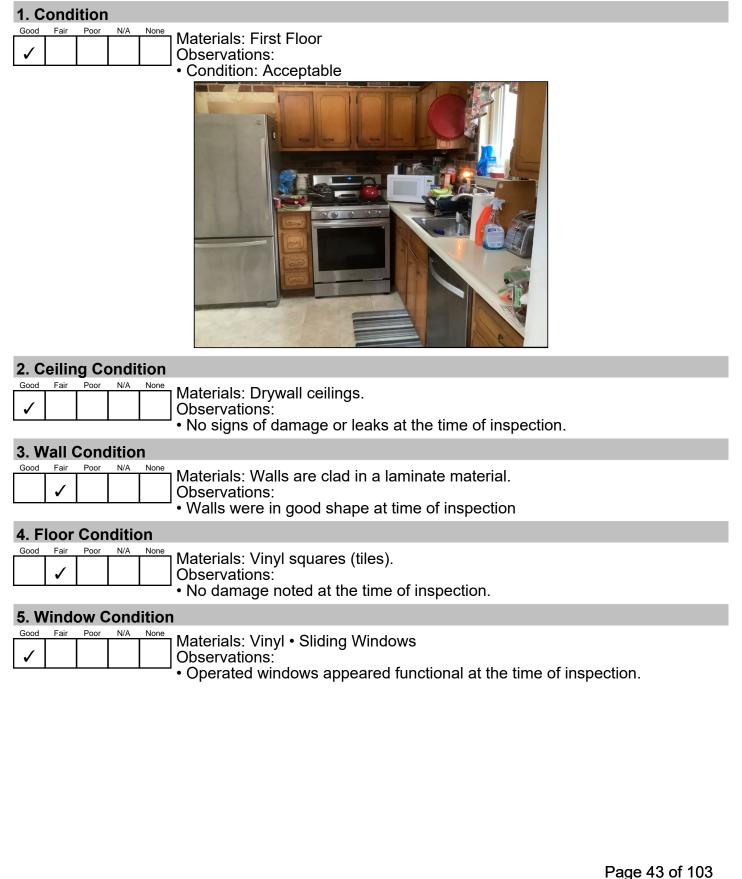



### 6. GFCI



#### Observations:

• GFCI protected receptacles may not have been required when the house was built. We suggest buyer consider upgrading with GFCI's at all receptacles within 6' from water sources, at kitchen island, and at kitchen counter-tops 12" or wider.

• No GFCI protection present. Recommend installing GFCI protected receptacles for safety.



#### 7. Cabinets Fair

1

Good

Poor N/A None Observations:

· Damaged /rotted wood noted under the kitchen sink, repair/replace as

- needed.
  - Loose cabinet door handle noted, repair as needed.



## 8. Dishwasher



ן Observations:

• The dishwasher appears in functional condition. It was not operated during the inspection because it was full of dishes and personal items.



# 9. Garbage Disposal



Observations: • Appeared functional when operated at the time of inspection.



## 10. Sinks

N/A



Observations: • Sink faucet is loose, suggest securing as necessary.





## 11. Spray Wand

Good	Fair	Poor	N/A	None	
					۱C
					•

Observations: • The spray wand was operated and was functional.



### 12. Plumbing Good Fair Poor N/A



None

Observations: • No active leaks in supply or drain lines observed at the time of inspection.



## 13. Microwave


Good	Fair	Poor	N/A	None
1				

Observations: • Microwave was functioning at the time of the inspection

## Next Day Inspect




## 14. Oven & RangeGoodFairPoorN/ANone

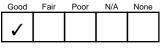

- Observations: Oven: gas burners The burners operated properly when tested. Oven(s) operated when tested.





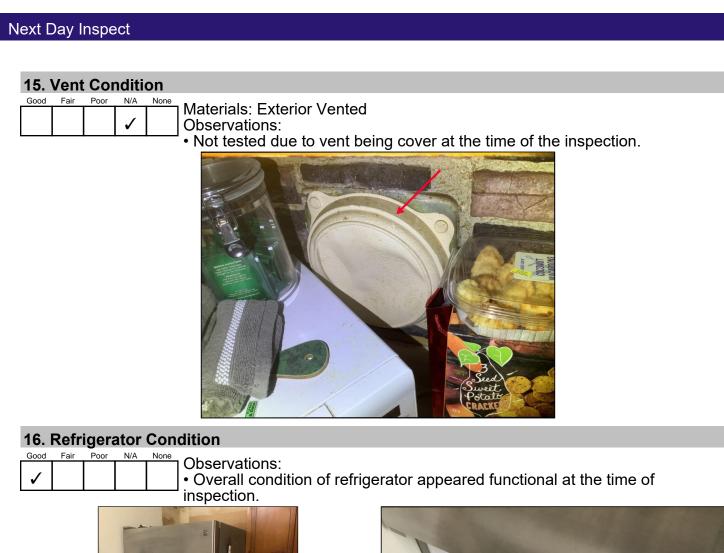








Laundry
1. General View Condition
Joan       Pair       Poor       NA       Materials: Basement Observations:         • Functional       • Functional       • Functional
2. Washer
Good Fair Poor N/A None Observations: ✓                                 Observations: • Appeared functional at the time of inspection.
3. Dryer
Good Fair Poor N/A None Observations: ✓                                 Observational at the time of inspection.
4. Dryer Vent
Good Fair Poor N/A None Observations: ✓

#### 5. Plumbing Eair

Good	Fair	Poor	N/A
<			

Observations: • Appeared to be in good shape at the time of inspection, access limited.

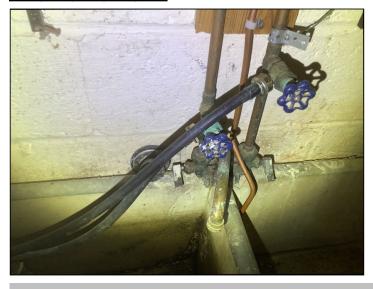

None




## 6. GFCI



Observations:

• GFCI protected receptacles may not have been required when the house was built. We suggest buyer consider upgrading with GFCI's at all receptacles near water sources.


• The laundry receptacle should be GFCI protected type. Recommend upgrade as needed.

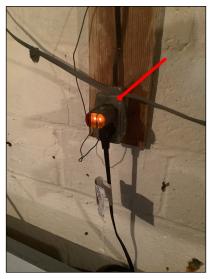

## 7. Wash Basin



Observations: • Drain line leaks under sink. Repair//replace as needed. • The laundry faucet leaks. Repair/replace as needed.

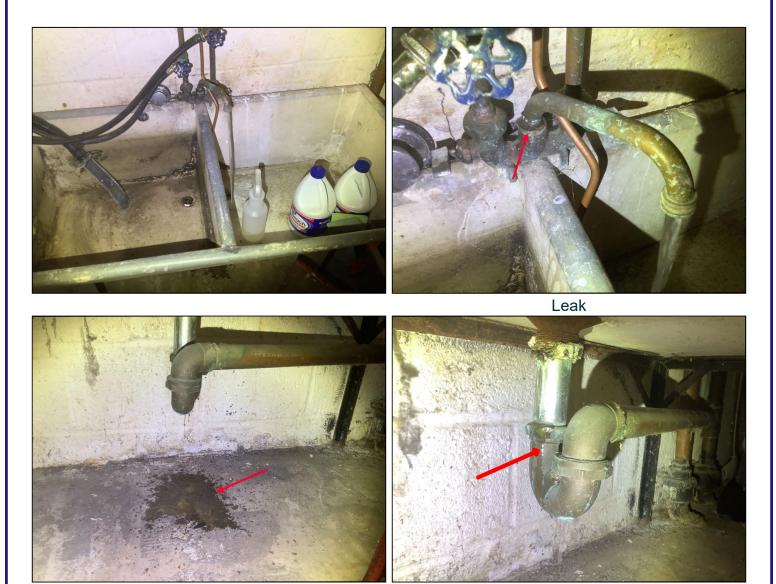

Leak

Leak

## 8. Gas Valves

N/A

None


Good Fair Poor

Observations: • Gas shut off valves were present and functional.






Page 53 of 103

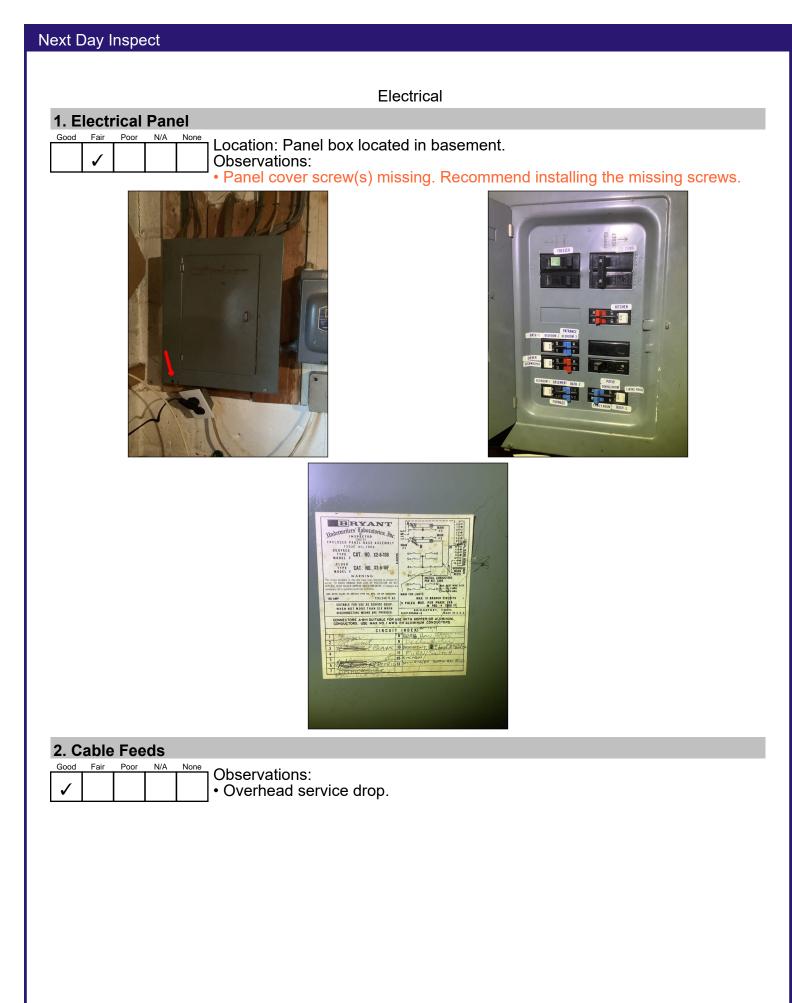

Page 54 of 103




## 3. Main Amp Breaker

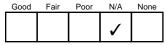

Observations:

• Split bus panel, there is no main switch in the electrical panel, breakers have to be turned off individually with 6 or less trows of the hand.



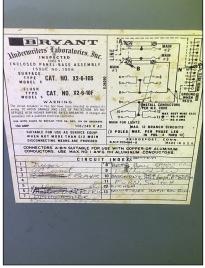

100 amp

#### 4. Breakers in off position Fair N/A Good Poor None Observations: • 0 5. Breakers Fair Poor N/A Good None Materials: Copper non-metallic sheathed cable. 1 Observations: • All of the circuit breakers appeared serviceable. • White wire connected to hot breaker switch, white wires are designated to neutral bus connection, replace or label as needed.







# Gas

1. Main Gas Valve Condition

N/A Fair Poor Good ✓

None

Location: Rear of structure. Observations: • Appeared in good shape at the time of inspection.



# Water & Sewer

## **1. Water Main** Good Fair Poor N/A None Location: Public Water

- 3/4 inch
- Copper pipes

• Corrosion noted around valve, no leaks noted at the time of the inspection, monitor the area for worsening condition.



Corrosion water main valve.

## 2. Plumbing












# 3. Hose bib shut off valve



Front

Back

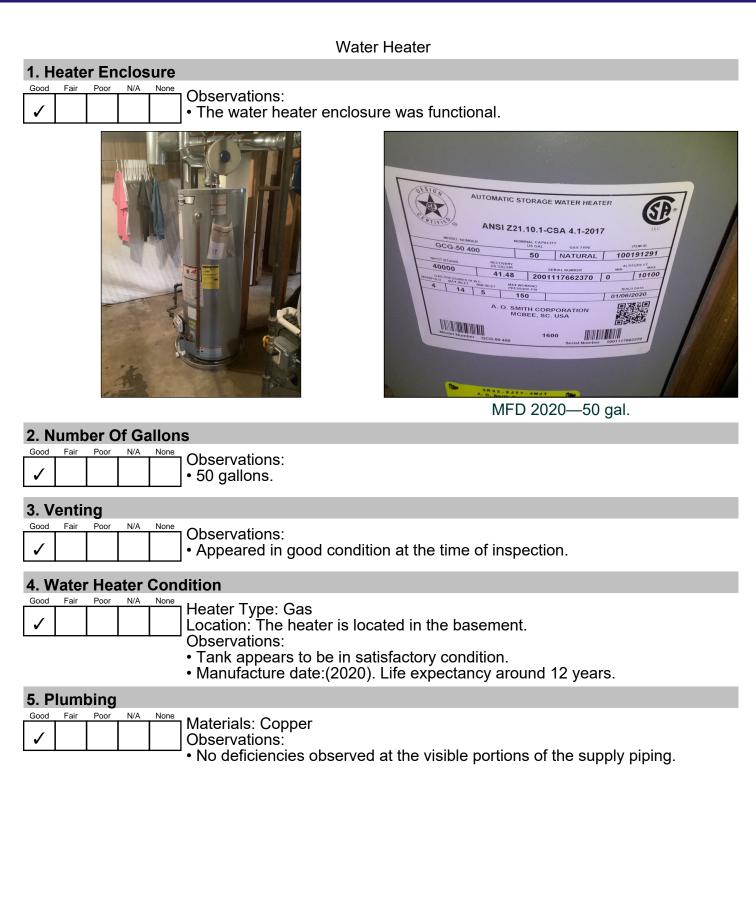



### 6. TPRV



#### Observations:

Observations:

• Temperature Pressure Release (TPR) valve and discharge pipe -- functional and in satisfactory condition.

• A Temperature Pressure Relief Valve (TPR Valve) is present. This safety valve releases water (and thus relieves pressure) if either the temp or pressure in the tank gets too high. The TPR valve discharge tube must be made of copper, iron, or CPVC (NOT regular PVC). It must terminate within 6" above the floor--the end cannot be threaded or have a fitting.



### 7. Gas Valve


Good Fair Poor N/A None

• Gas valve present and appeared functional.




Page 62 of 103

HVAC Zone 1
1. AC Compress Condition
Good Fair Poor N/A None Compressor Type: Electric Location: The compressor is located on the back yard. Observations: • NOTE: Unit(s) not tested in the cooling mode. A/C units should not be operated when the ambient temperature is below 65°F as damage to the un could occur. This test is excluded from the scope of this inspection due to th ambient temperature. • Manufacture date:(2019). Life expectancy around 20 years. • Maintenance Tip: Recommend that HVAC professional seasonally check the air conditioning unit, and ensure the unit is level. This can be
<image/>
$\begin{tabular}{ c c c c c c c c c c c c c c c c c c c$

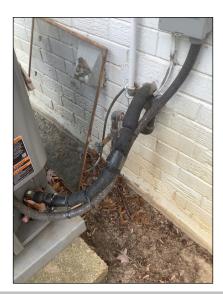

## 3. Thermostats

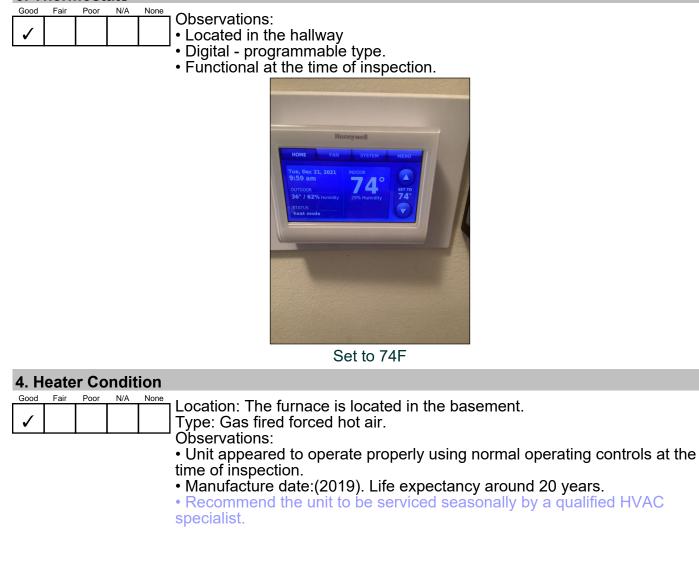









### 5. Filters



Location: Located left side of the heater in a slot cut into the ductwork. Observations:

• The furnace filter is dirty. Filters help clean the house air, making the environment more pleasant. Filters also clean the air before it passes through the blower and heat exchanger. This helps to keep these furnace components working efficiently. It is recommended to change the filter and then regular inspection & maintenance is advised.The filter is dirty. Needs replacement.



## 6. Venting Good Fair Poor



None Observations: • Metal double wall chimney vent pipe noted.



## 7. Enclosure



Observations: • Appeared to be in good shape at the time of inspection. • The blower appear to operate normal at the time of the inspection.



## 8. Registers



Observations: • Functional and achieved adequate differential temperature between supply and return air.



Heating mode supply

Heating mode return

## 9. Gas Valves



Observations: • Gas shut off valves were present and functional.



## 10. Plumbing Good Fair Poor N/A



Observations: • Appeared functional and in good condition.



## Next Day Inspect


# **Radon Unit Placement**

## 1. Radon Placement


Good Fair Poor N/A None Materials: Basement





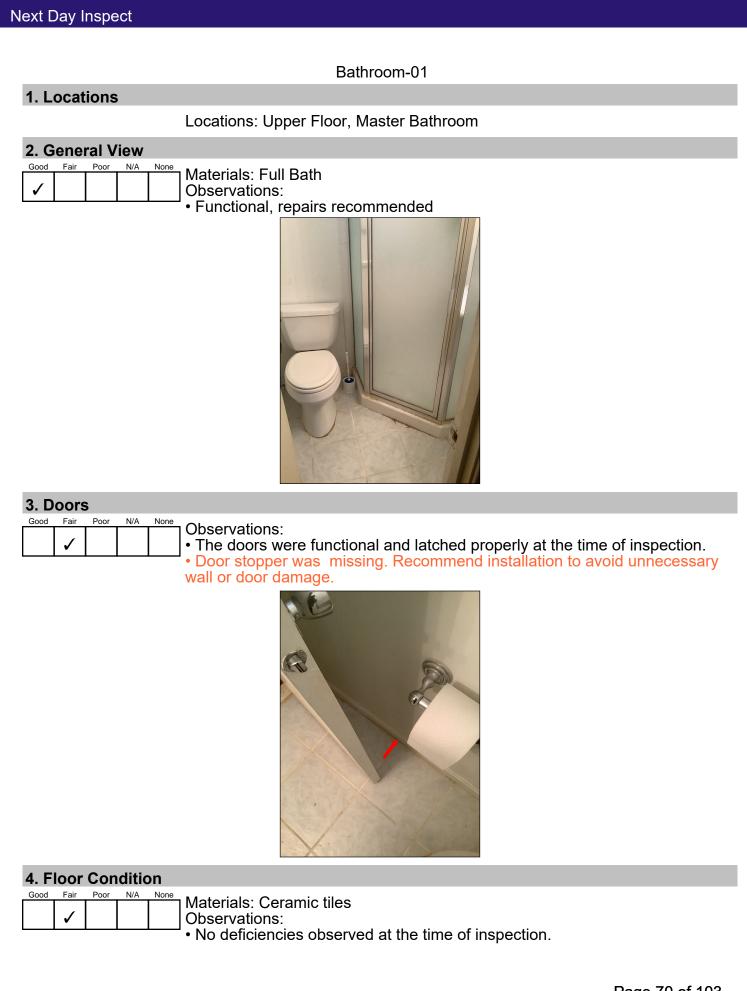

Page 70 of 103

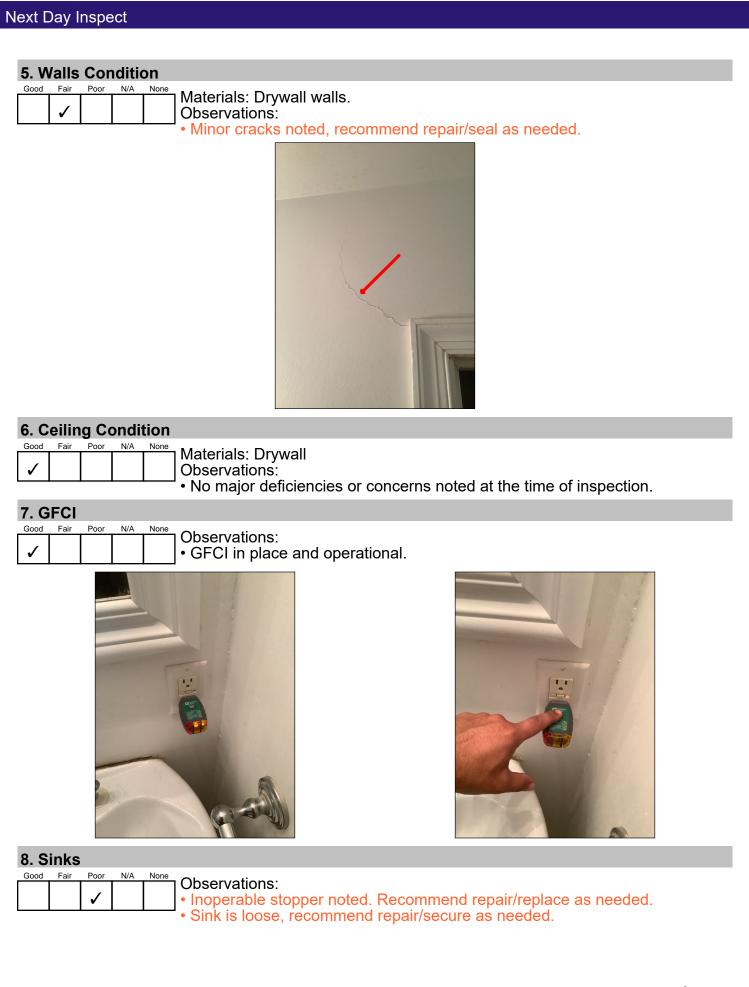





Loose sink


#### 9. Plumbing Good Fair Poor



Observations: • All fixtures tested and operated normally. No functional or safety concerns noted at the time of inspection.




# 10. Showers

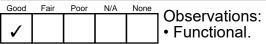



#### **11. Shower Walls**

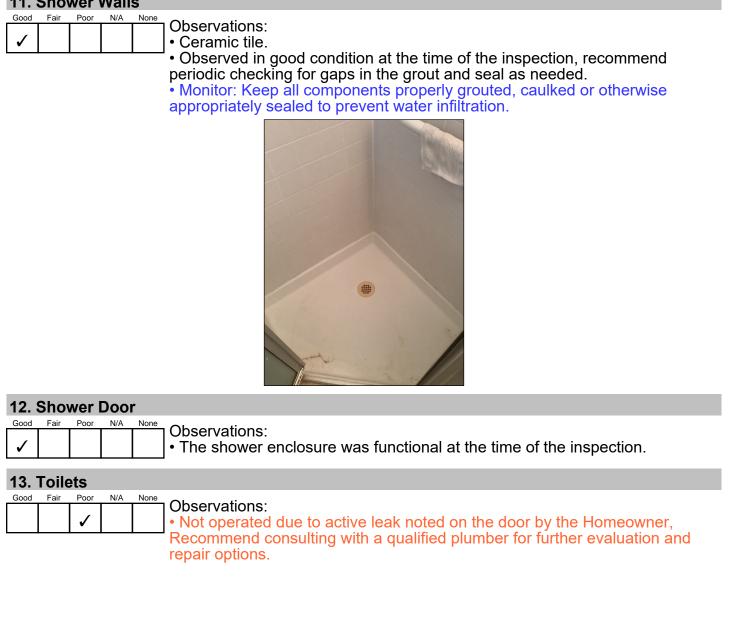

Page 73 of 103




# 14. Window Condition

Good	Fair	Poor	N/A	None
~				

Type: Vinyl • Sliding Windows • Double pane Observations: • Appeared in good condition.



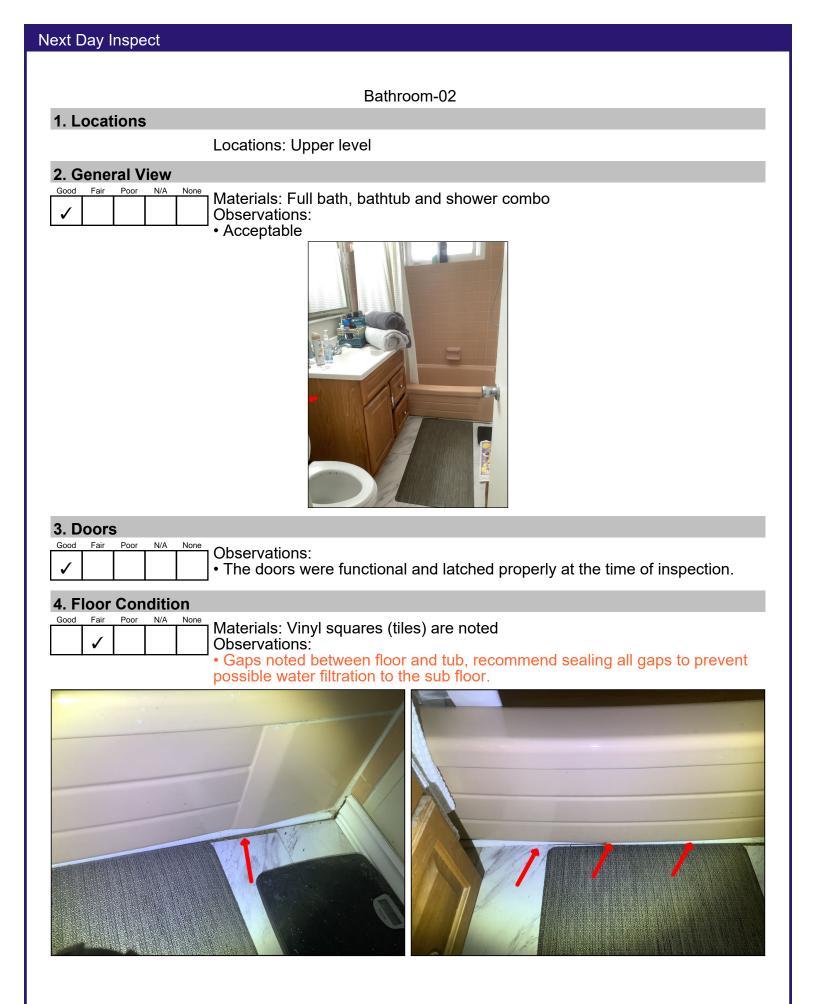

# 5. Walls Condition N/A Fair Poor Good None Materials: Drywall walls. Observations: 1 • Loose baseboards noted, repair/secure as needed. 6. Ceiling Condition Fair Poor N/A Good None Materials: Drywall ceilings. Observations: • No major deficiencies or concerns noted at the time of inspection. 7. GFCI Poor N/A None Good Fair

Guuu	1 all
~	

Observations: • GFCI in place and operational.





#### 8. Sinks

Good

Fair

1

Poor N/A None Observations:

Inoperable stopper noted. Recommend repair/replace as needed.
Damaged faucet handle noted, repair/replace as needed.





# 9. Plumbing Good Fair Poor




Observations:

Stains noted under the sink, tested dry at the time of the inspection, monitor the areas for possible water leaks.
Older style metal traps noted. Buyer is cautioned that these traps can leak at any time due to corrosion.



# Next Day Inspect



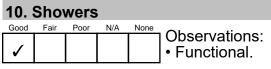



# 11. Shower Walls



Observations: • Ceramic tile. • Caulk deterioration observed, repair/ re caulk as needed.






### 12. Bath Tubs


	Good	Fair	Poor	N/A	None	
						Observations:
	$\checkmark$					• Tub
ļ						

• Bathtubs appeared in good condition, water supply appeared adequate, and drainage was functional at the time of inspection.





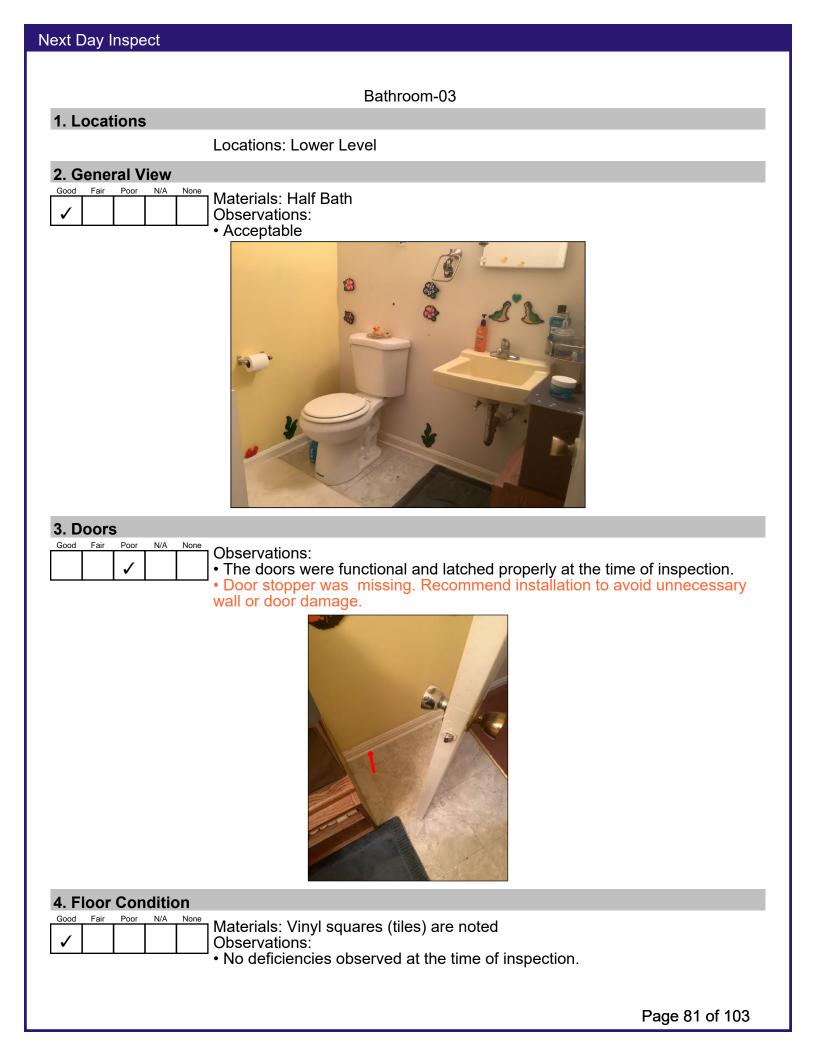

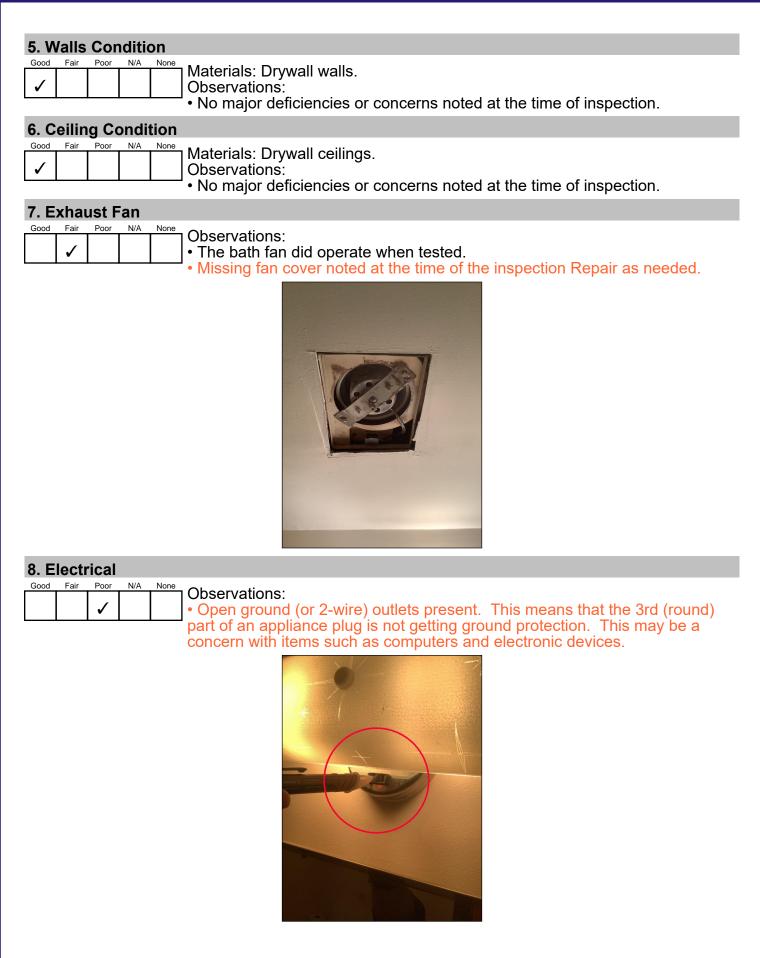

Next Day Inspect
9. Sinks Good Fair Poor N/A None Observations: ↓ Observations: • Inoperable stopper noted. Recommend repair/replace as needed.
<b>10. Plumbing</b> Good Fair Poor NA None ✓ Observations: • Older style metal traps noted. Buyer is cautioned that these traps can leak at any time due to corrosion.
<image/>
<ul> <li>11. Toilets</li> <li>Good Fair Poor N/A None Observations:</li> <li>● Toilet did not flush at the time of the inspection, loose handle noted. Repair as needed.</li> </ul>



#### 12. Heating Good Fair Poor



Observations: • Missing register cover noted. Repair as needed.



Missing register

# Bedroom-01 **1. General View Condition** Good Fair Poor N/A None Materials: Upper Floor 1 Observations: · Acceptable, some repairs needed 2. Doors Fair N/A Good Poor None Observations: $\checkmark$ • Bedroom door didn't latch when tested. Recommend repair as needed. 3. Ceiling Condition Good Fair Poor N/A None Materials: Drywall ceilings. Observations: • No deficiencies or stains noted at the time of inspection. 4. Wall Condition Good Fair Poor N/A None Observations: • Large stains noted on the walls. They tested dry at the time of the 1 inspection. Recommend consulting with the appropriate contractor for further evaluation and repair /replace the damaged areas as needed.

Page 85 of 103





Areas tested dry at the time of the inspection.



# 5. Floor Condition

Fair N/A None Good Poor 1

Flooring Types: Carpet.Observations:Stains observed on the carpet. Recommend clean/replace as needed.



#### 6. Window Condition None

Good	⊦aır	Poor	N/A
	1		


Materials: Vinyl • Sliding Windows • double pane Observations:
Operational at the time of the inspection.
Stains noted around window frame, areas tested dry at the time of the inspection, monitor the areas for possible water intrusion.









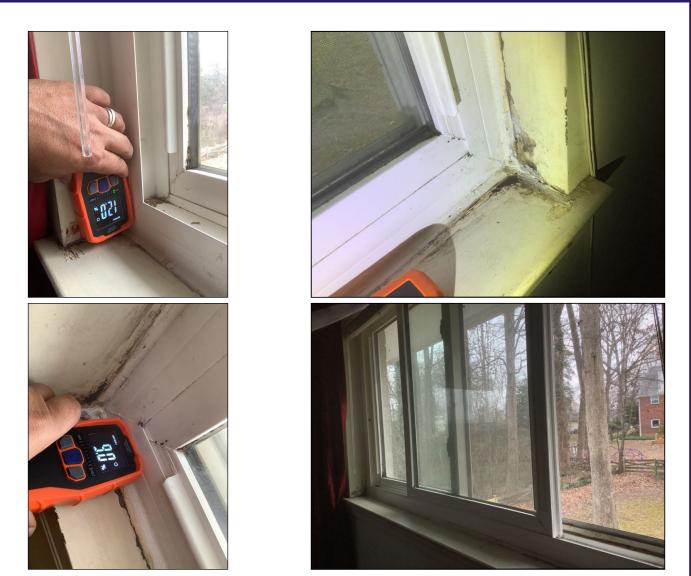



#### 7. Electrical



Observations: • The home contained outdated, ungrounded 2-prong electrical outlets. Consider updating the existing condition to meet current standards.



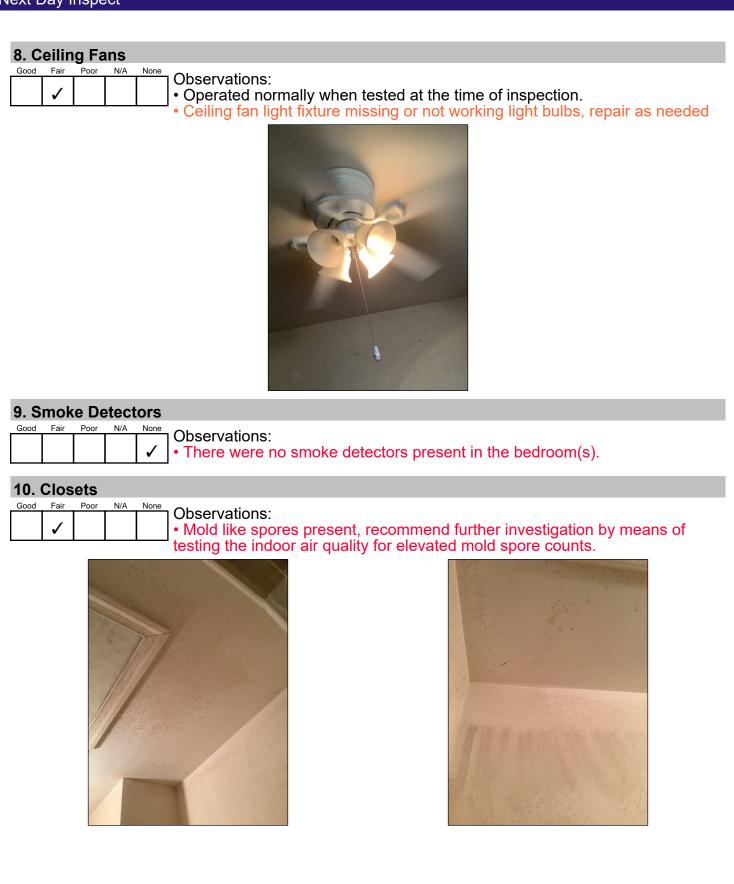

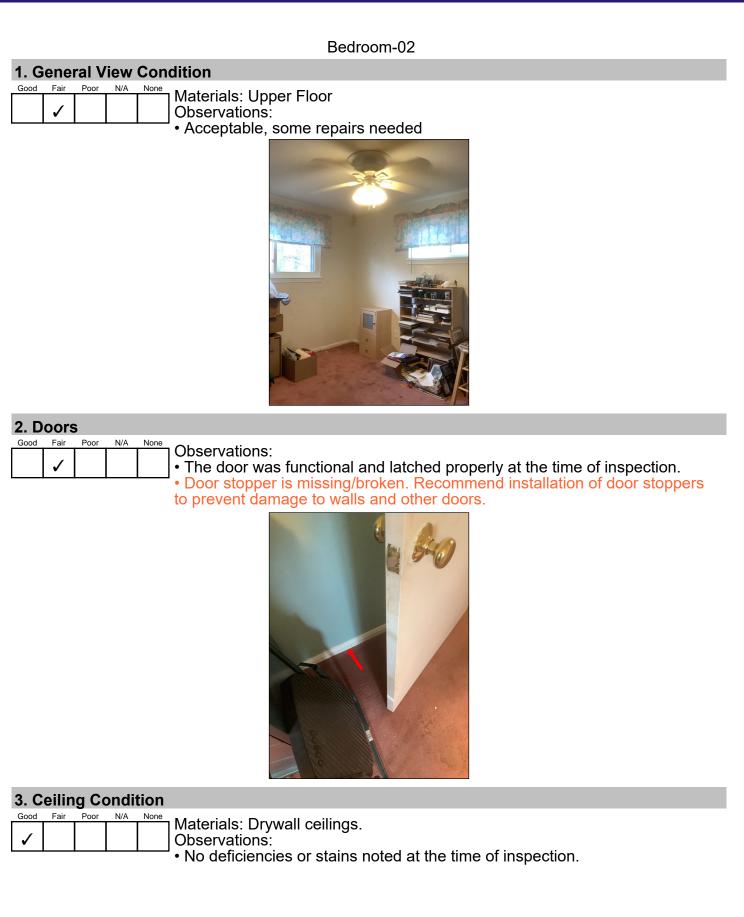

# 4. Wall Condition

Good	Fair	Poor	N/A	None	
					) Ma
	<ul> <li>✓</li> </ul>				Ob
	-				· ~

Materials: Drywall.
Observations:
.

• Large stains noted on the walls. They tested dry at the time of the inspection. Recommend consulting with the appropriate contractor for further evaluation and repair /replace the damaged areas as needed.





Tested dry at the time of the inspection.

# 5. Floor Condition



Flooring Types: Carpet. Observations:

• Stains observed on the carpet. Recommend clean/replace as needed.








Materials: Vinyl • Sliding Windows • double pane Observations:

• Operational and no deficiencies noted.



#### 7. Electrical



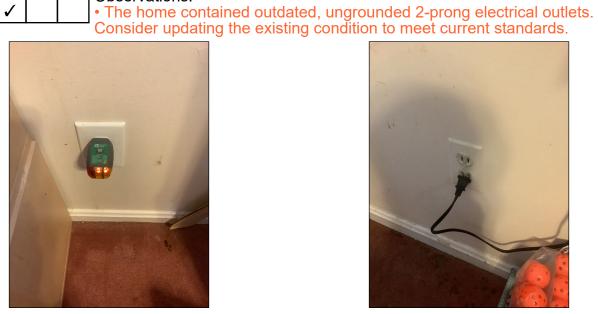

Observations:




Two prong

## 8. Smoke Detectors



Observations: • There were no smoke detectors present in the bedroom(s).

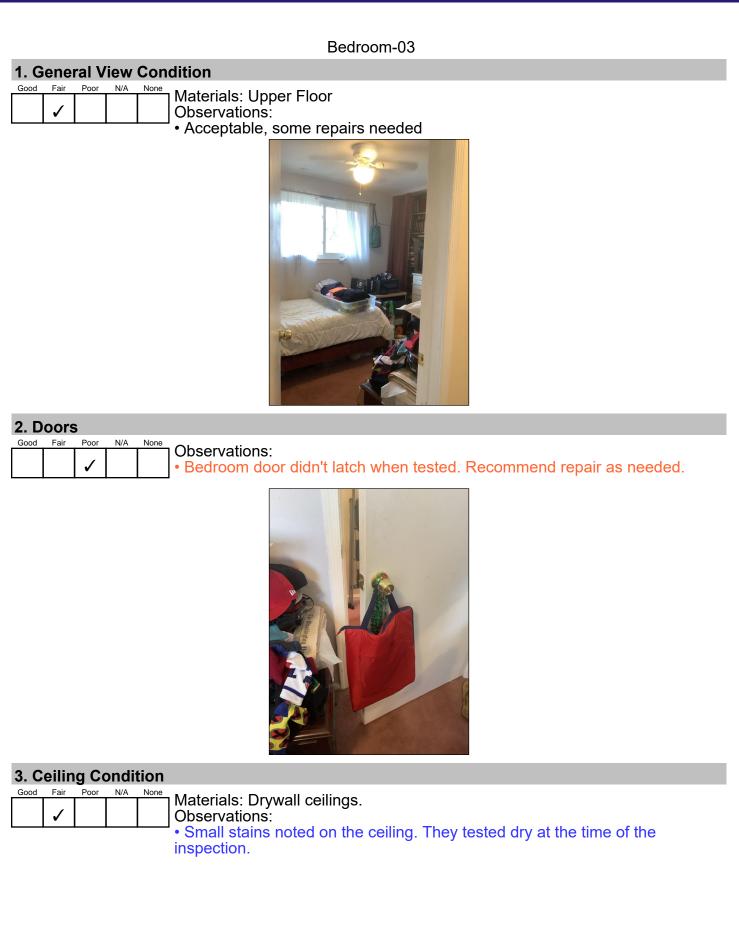





Tested dry at the time of the inspection

## 4. Wall Condition



Materials: Drywall. Observations: • Some areas not accessible due to stored personal items.

## 5. Floor Condition

Good	Fair	Poor	N/A	None	
		~			ľ

Flooring Types: Carpet. Observations: • Stains observed on the carpet. Recommend clean/replace as needed.



#### 6. Window Condition



Materials: Vinyl • Sliding Windows • double pane

Observations: • Not accessible at the time of the inspection.

# Next Day Inspect



# 7. Electrical

Good	Fair	Poor	N/A	None	
					Observations:
					• Outlets not accessible due to furniture and or stored personal items.
					·

# 8. Ceiling Fans

Good	Fair	Poor
1		

Observations:

• Operated normally when tested at the time of inspection.

# 9. Smoke Detectors

N/A

Poor N/A None Observations: ✓ There were no smok

• There were no smoke detectors present in the bedroom(s).

#### Rec Room

#### **1. General View Condition**

None



Materials: Lower Level Observations: • Not accessible





#### 2. Doors

Good Fair Poor N/A None


Observations: • All doors and locks appeared functional and operated normally at the time of inspection.

#### 3. Ceiling Condition

None



Materials: Drywall ceilings.

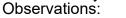

• Ceiling appeared to be in good condition at the time of inspection.


#### 4. Wall Condition




Materials: Walls are clad in paneling.

**Observations:** 

· Some areas not accessible due to stored personal items.

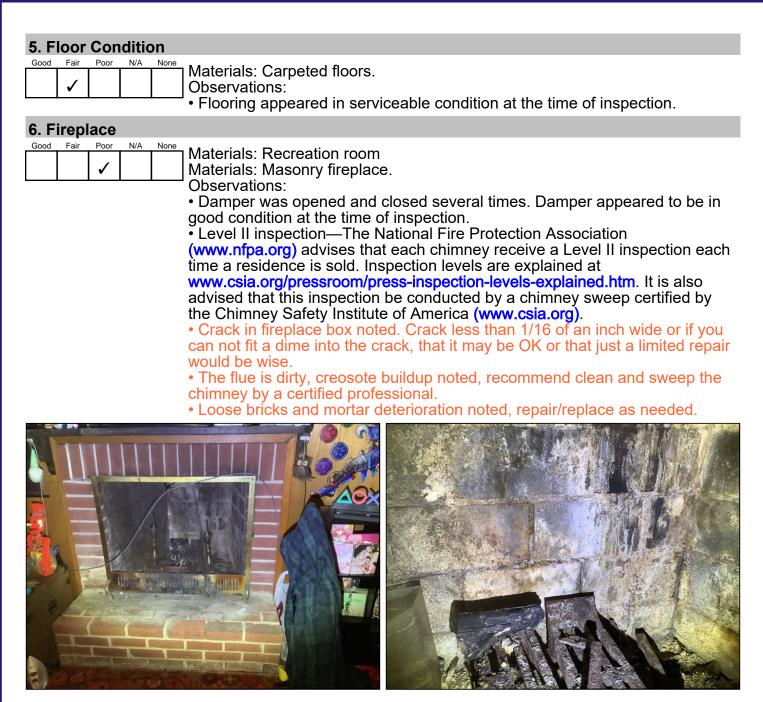

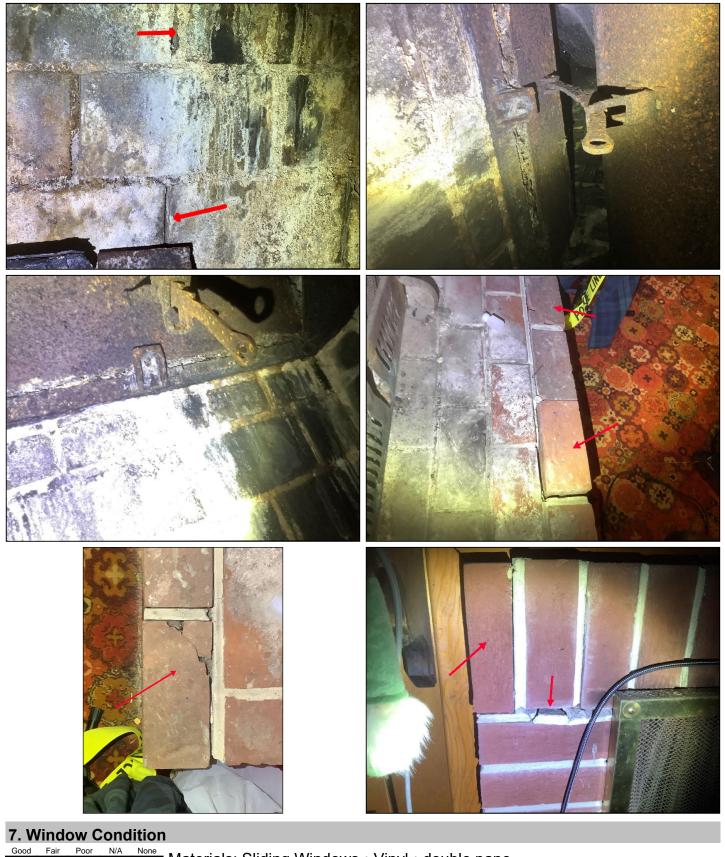



Materials: Sliding Windows • Vinyl • double pane Observations: • No accessible

Page 98 of 103



#### 8. Electrical



None

Observations: • Light fixtures or bulbs inoperable. Change bulb and check.




#### 9. Smoke Detectors



Observations:

Old detectors. Smoke detectors last 6-10 years. Recommend replacing.
Testing of smoke detectors is not included in this inspection. Pushing the "Test" button only verifies that there is power at the detector--either a battery or hard wired to the house power--and not the operational workings of the detector. The operational check is done by filling the sensor with smoke and is beyond the scope of this inspection. Battery operated smoke alarms should be checked routinely and the batteries changed frequently.
SAFETY CONCERN: The smoke alarm(s) did not operate when tested. You need to be alerted in case of a fire. Recommend repair or replacement of the smoke alarm.



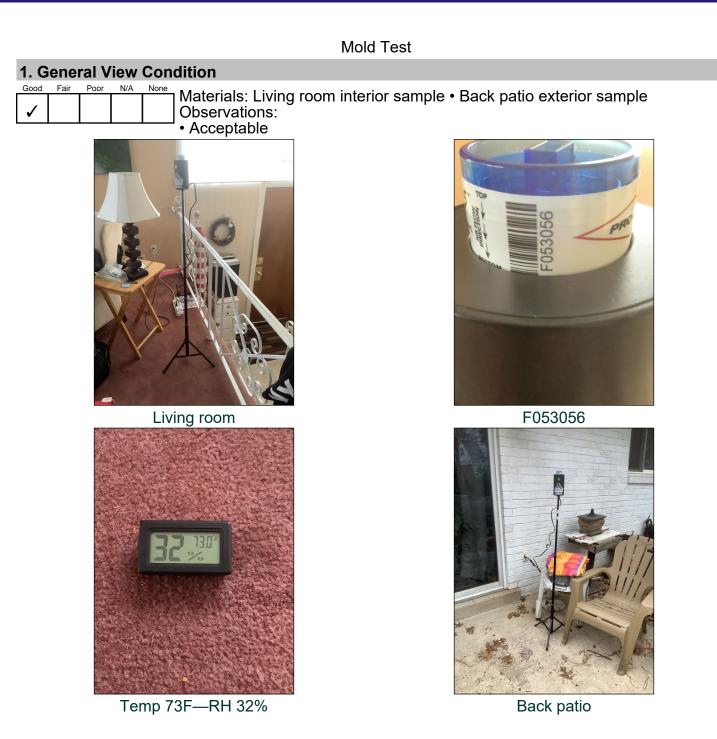



F227231



Temp 47.3/ RH 34%

# Glossary

Term	Definition
A/C	Abbreviation for air conditioner and air conditioning
Cellulose	Cellulose insulation: Ground-up newspaper that is treated with fire-retardant.
GFCI	A special device that is intended for the protection of personnel by de-energizing a circuit, capable of opening the circuit when even a small amount of current is flowing through the grounding system.
PVC	Polyvinyl chloride, which is used in the manufacture of white plastic pipe typically used for water supply lines.
Smoke Detector	The life expectancy of smoke alarms is generally 10 years, after which point their sensors can begin to lose sensitivity. If the smoke detector has some discoloration "yellowish", then is very likely an old and noneffective smoke detector and it needs to be replaced. Most smoke detectors have an expiration date imprinted on the back. The test button only confirms that the battery, the hard-wire to the house power, the electronics, and the alert systems are working; it does not mean that the smoke sensor is working. Battery operated smoke alarms should be checked routinely and the batteries changed frequently (at least every year). Testing of the smoke detector's sensor is beyond the scope of standard home inspection. The operational test of a smoke detector is done by filling the sensor with smoke and is beyond the scope of this inspection.
TPR Valve	The thermostat in a water heater shuts off the heating source when the set temperature is reached. If the thermostat fails, the water heater could have a continuous rise in temperature and pressure (from expansion of the water). The temperature and pressure could continue to rise until the pressure exceeds the pressure capacity of the tank (300 psi). If this should happen, the super-heated water would boil and expand with explosive force, and the tank would burst. The super-heated water turns to steam and turns the water heater into an unguided missile. To prevent these catastrophic failures, water heaters are required to be protected for both excess temperature and pressure. Usually, the means of protection is a combination temperature- and pressure- relief valve (variously abbreviated as T&P, TPV, TPR, etc.). Most of these devices are set to operate at a water temperature above 200° F and/or a pressure above 150 psi. Do not attempt to test the TPR valve yourself! Most water heating systems should be serviced once a year as a part of an annual preventive maintenance inspection by a professional heating and cooling contractor. From Plumbing: Water Heater TPR Valves